

NK-frozen-cross-feed-mount-bushing

Large Dial CF Mount Bushing - Spanner hole in mount bushing not drilled.

Don't use vise grips, try this first:

Drill the spanner hole 3/16 dia. 5/32 deep, 3/8 to center from end of bushing. Heat the saddle around the mount bushing with a heat gun, not a torch, with a cold wet rag on the mount bushing. Heat it up, let it air cool, heat it up, let it air cool, heat it up let it air cool. 3 times or so. Thermal expansion of dissimilar metals should, help it break free, then try a spanner tool.

Steve Wells
